



SERVICE BULLETIN n°990201

9, rue de l'Aviation
21121 DAROIS
Tel 03 80 35 65 10
Fax 03 80 35 65 15

ATA SYSTEM : 56
EFFECTIVITY : CAP10B
TITLE : Canopy locking hook

Issue	Revision	Date	Reason for change	Visa
0	0	04/02/99	Original issue	

1. PLANNING INFORMATION

1.1. EFFECTIVITY

Aircraft	CAP10B		
Serial n°	All		

1.2. REASON

	SERVICE BULLETIN	DELAY FOR APPLICATION
	Optional	
X	Recommended	As soon as the SB issue
	Mandatory	

During a training flight, after 10 minutes flying, the pilot notices the locking hook failure which led to a light back opening of the canopy and the partial disassembly of the left Plexiglas part.
This SB aims to give indications to prevent such incidents.

1.3. DESCRIPTION

The locking hook failure appears after an excessive filing of the tumbler. It is sometimes necessary to modify this part in order to adjust the installation of a new windshield.
The material quantity left on the locking hook must be at least of 9 mm (0.35 in) minimum.
This measure is accompanied with an inspection of the part.

1.4. APPROVAL

This Service Bulletin has been reviewed by the DGAC by the letter ref. 99155 L.CA/FR. and the repairs and modifications herein comply with the AIR2052 amendment 10/11/69 and are APPROVED for the installation in the CAP10B.

1.5. MANPOWER

None.

1.6. MATERIAL

None.

1.7. TOOLING

None.

9, rue de l'Aviation
 21121 DAROIS
 Tel 03 80 35 65 10
 Fax 03 80 35 65 15

ATA SYSTEM : 56
 EFFECTIVITY : CAP10B
 TITLE : Canopy locking hook

1.8. WEIGHT & BALANCE

1.8.1. Aircraft

None.

1.8.2. Engine

None.

1.8.3. Accessory or Component for aircraft use

None.

1.9. ELECTRICAL LOAD DATA

None.

1.10. REFERENCES

None.

2. ACCOMPLISHMENT INSTRUCTIONS

2.1. MATERIAL LEFT

- A. Check the hook (located #49 on the 15B planch of the Parts catalogue)
- B. The tumbler depth must not be so that material quantity left is **9 mm (0.35 in) minimum**
- C. Replace the part if non complying

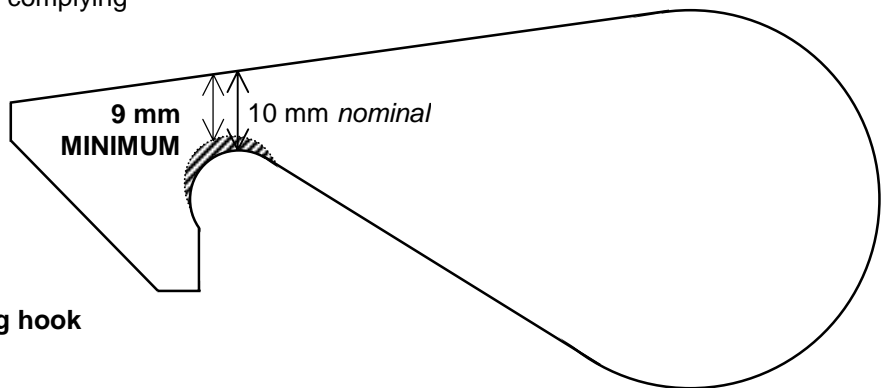


Figure 1 : Canopy locking hook

2.2. FREQUENT VISUAL INSPECTION

- A. Check visually the canopy locking hook each **50 hours inspection**

3. MATERIAL INFORMATION

New P/N	Quantity	Unit list price	Key word	Old P/N	Instructions
-	1	348.11F	Hook	CAP10 10-19-20	Remove if non complying